

Missile LXQ Series - LXQR4000 IR340A Shank

Hammer Service Log


Wear Sleeve / Piston Clearance

| Part | New Dimension | | Discard Clearance |
|-------------|---------------|--------|---------------------------------|
| Wear Sleeve | A | 3.071" | greater than or equal to 0.010" |
| Piston OD | B | 3.067" | |




Inner Cylinder / Piston Clearance

| Part | New Dimension | | Discard Clearance |
|-------------|---------------|--------|---------------------------------|
| Cylinder ID | C | 2.441" | greater than or equal to 0.010" |
| Piston OD | D | 2.437" | |

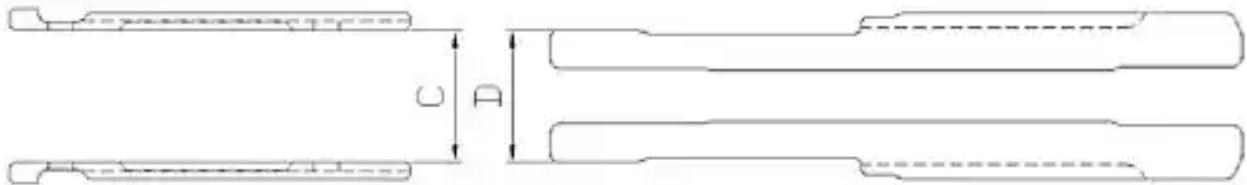

Distributor Probe / Piston ID Clearance

| Part | New Dimension | | Discard Clearance |
|----------------------|---------------|--------|---------------------------------|
| Distributor Probe OD | F | 1.019" | greater than or equal to 0.010" |
| Piston ID | E | 1.024" | |

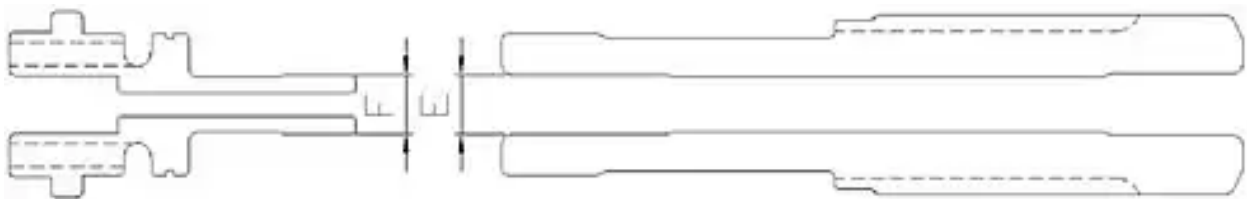

External Wear

| Description | Wear Limit |
|---|------------|
| Wear Sleeve Discard Dimension | 3.425" |
| NOTE: Chuck should be replaced when wear transfers to wear sleeve. | |