



► Nova 10" Hammer SD10 Service Log ◀

Hammer Service Log





**WEAR SLEEVE / PISTON CLEARANCE**

Part	New Dimension		Discard Clearance
Wear Sleeve	A	6.85" (174mm)	≥0.010" (0.25mm)
Piston O.D	B	6.845" (173.86mm)	

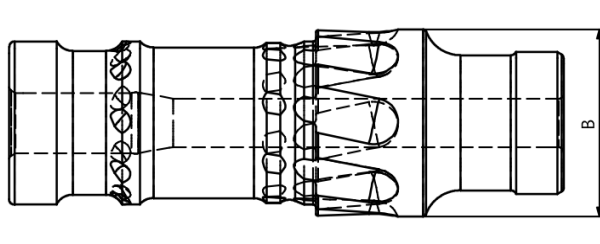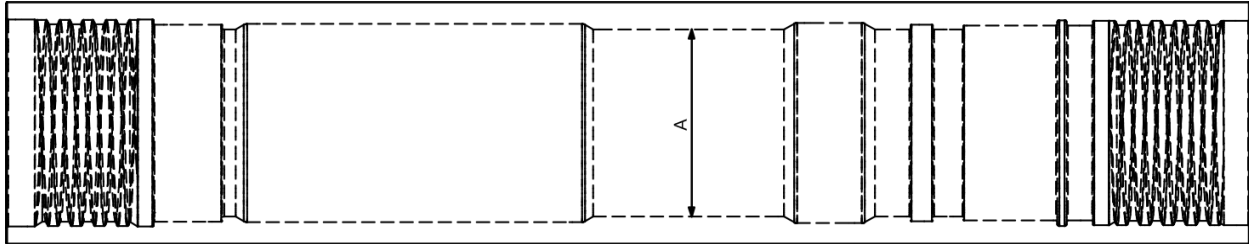


**INNER CYLINDER / PISTON CLEARANCE**

Cylinder I.D	C	5.984" (152mm)	≥0.010" (0.25mm)
Piston O.D	D	5.978" (151.85mm)	

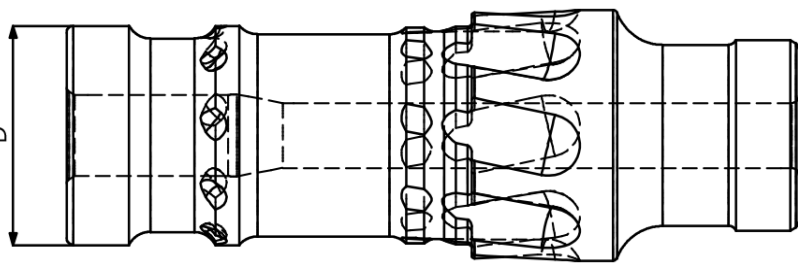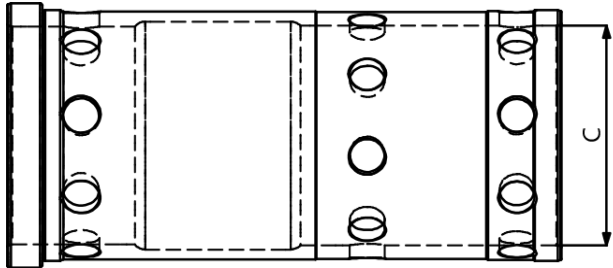


**DISTRIBUTOR PROBE / PISTON ID CLEARANCE**

Distributor Probe O.D	F	2.195" (55.75mm)	≥0.010" (0.25mm)
Piston I.D	E	2.204" (56.0mm)	

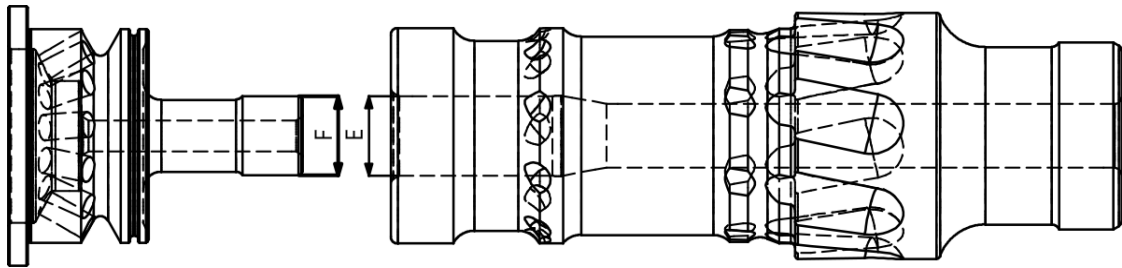

**Bearing / PISTON OD CLEARANCE**

Bearing I.D	H	5.216" (132.5mm)	≥0.010" (0.25mm)
Piston O.D	G	5.201" (132.1mm)	

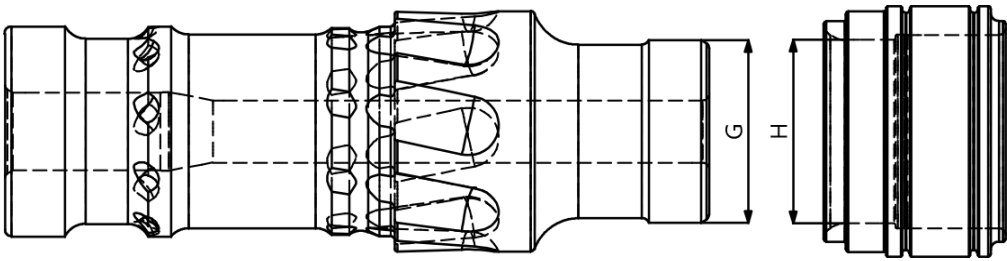

**note.**

1. Chuck should be replaced when wear transfers to wear sleeve.